

CORIOgrapher (v2.8.3.4)

This software is for:

 Hardware: CORIOmaster[™] (C3-540), CORIOmaster[™] mini (C3-510), CORIOmaster[™] micro (C3-503), & CORIOview.

Firmware [CORIOmaster] : M406 or laterFirmware [CORIOview] : M406 or later

o use CORIOdiscover V1.6.2.1 or later to update to this firmware.

Software: CORIOgrapher v2.8

For help with connecting, setting up, and using CORIOgrapher, see CORIOgrapher Help, or the Quick Start Guide that came in the box.

Downloads

Download the latest firmware here: tvone.com/firmware-updates

Download the latest control software here:

CORIOgrapher: tvone.crmdesk.com/answer.aspx?aid=20766

CORIOdiscover: tvone.crmdesk.com/answer.aspx?aid=21697

Previous releases

Read details on previous releases here:

tvone.crmdesk.com/image.aspx?mode=file&id=14137

Contact us

www.tvone.com

tvone NCSA tvone emea

North, Central and South America Europe, Middle East, Africa and Asia Pacific

Sales: sales@tvone.com
Support: tech.usa@tvone.com
Support: tech.europe@tvone.com




CORIOgrapher (v2.8.3.4)

Released by: Neil Baptiste 18/10/19

[New Features CORIOview M407 and above only]

EDID Manager:

- The ability to select which EDID is used for an input.
 - Option is available for DVI, HDBaseT, HDMI 2K and 4K, and AVIP input modules.
- Upload EDID to the device.
 - User can upload and delete user EDIDs from device from the EDID manager in Settings.
- CG: Dashboard: **Rotate** display by 90 degrees increments.

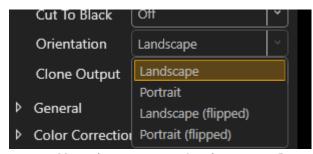

- Moved output rotation button to Properties panel as it is setup behavior.
- CG: Dashboard: Support for cloned output.



- Added support for model access metadata that can now be varied based on the product.
- CORIOgrapher will now automatically save the console log to Documents\CORIOgrapherV2\CORIOgrapherError.Console.log. if the application crashes. (No passwords are saved in the file.)
- CORIOgrapher will now launch a web browser to visit online help pages for CORIOmaster and CORIOview.
- Encoder100 and Media manager dialog (?) help is contextual depending on the configuration loaded.



Fixed

- CORIOgrapher will now connect to M406 builds but the EDID manager is only supported in M407 and above builds.
- CG will not look for EDID information within M406 builds.
- Cutting consecutive items from the Internal storage crashes/closes CG.
- Could not add a Window (source) to the canvas using CORIOgrapher.
- CORIOgrapher for CORIOview writing to read-only or non-existent fields.
- Bezel Top text is incorrectly positioned under 'Add Display'.
- CORIOgrapher disconnects when waiting for standby Resumed event. [when pressing standby from the front panel].
- CORIOgrapher crashes if undesired character is in [equipment] Display Name field.
- FW not allowing Aliases that are the same as item name for example Window1.

Notes

Known Issues:

- Encoder Manager dialog uses tabs and the tab default behavior changes the selected tab highlight when the mouse hovers over child items.
- Third-party ColorPicker control is difficult to customize so the Advanced section has some dark text on a dark background.
- Application Window title bar is not themed, this will be done for the next release.
- Canvas Cut-to-black will overwrite the current output cut-to-black and canvas audio mute values. The hope is to have this behavior supported by the firmware in a post 406 release, so the current values can be maintained.